



PIC96B 110 V

PIC96B 110 V, Phasemeter

Code: M13634. DESCATALOGADO

- > Scale: 360°, P1
- > System: Balanced three-phase
- > Accuracy: 1,5
- > Measurement Range (V): 110
- > Modules: 96x96

Description

- Does not need an auxiliary power supply
- DIN box with dimensions 96 and 144.
- Class 1.5
- Balanced and unbalanced single and three-phase circuits.
- 4 quadrants

Application

Measurement of $\cos\phi$ in balanced or unbalanced single and three-phase circuits.



PIC96B 110 V

Phasemeters

Code: M13634.

Specifications

Mechanical characteristics

Size (mm) width x height x depth	96 x 96 x 101.2 (mm)
Fastening	Panel
Weight (kg)	1,41

Environmental characteristics

Protection class	Panel: IP 52 (Front), IP 00 (Terminals)
Storage temperature	-25...+40 °C
Operating temperature	+10 ... +30 °C

Standards

Certifications	CE, UL
Electrical safety, Maximum height (m)	2000
Standards	BS 89, UNE-EN 60051, IEC 144, UL 94, DIN 43780, IEC 51, UNE 21318

Current measurement circuit

Consumption	4 VA
Sampling frequency	20 ... 100 Hz
Nominal current (In)	... 5 A
Allowable overload	1,2 In permanent / 5 In during 30s / 10 In during 5s / 40 In during 1s

Voltage measurement circuit

Consumption	20 mA
Sampling frequency	49,5 ... 50,5 Hz / 59,4 ... 60,6 Hz

Electrical characteristics

Insulation voltage, circuit	2 kV a 50 Hz <1 min entre mecanismo y caja
-----------------------------	--

Measurement accuracy

Accuracy	± 1,5 % FE
----------	------------

PIC

Induction phasemeters

CODE	TYPE	Scale	Accuracy	Modules
Single-phase				
M13631.	PIC96A 110 V	360°, P1	1,5	96x96
M13632.	PIC96A 230 V	360°, P1	1,5	96x96



PIC96B 110 V

Phasemeters

Code: M13634.

CODE	TYPE	Scale	Accuracy	Modules
M13633.	PIC96A 400 V	360°, P1	1,5	96x96
M13641.	PIC144A 110 V	360°, P1	1,5	144x144
M13642.	PIC144A 230 V	360°, P1	1,5	144x144
M13643.	PIC144A 400 V	360°, P1	1,5	144x144
Balanced three-phase				
M13634.	PIC96B 110 V	360°, P1	1,5	96x96
M13635.	PIC96B 230 V	360°, P1	1,5	96x96
M13636.	PIC96B 400 V	360°, P1	1,5	96x96
M13644.	PIC144B 110 V	360°, P1	1,5	144x144
M13645.	PIC144B 230 V	360°, P1	1,5	144x144
M13646.	PIC144B 400 V	360°, P1	1,5	144x144
Unbalanced three-phase				
M13637.	PIC96E 110 V	360°, P1	1,5	96x96
M13638.	PIC96E 230 V	360°, P1	1,5	96x96
M13639.	PIC96E 400V	360°, P1	1,5	96x96
M13647.	PIC144E 110V	360°, P1	1,5	144x144
M13648.	PIC144E 230V	360°, P1	1,5	144x144
M13649.	PIC144E 400V	360°, P1	1,5	144x144

Current range: 0.1 to 1.2 In. For the connection of transformers .../5A.




PIC96B 110 V

Phasemeters

Code: M13634.

Dimensions

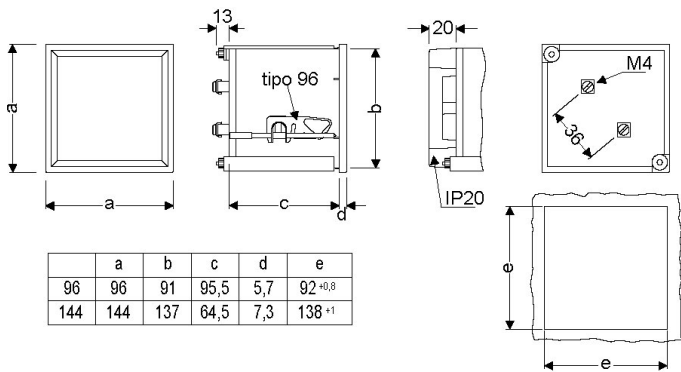

Connections

