



WI/TS

WI/TS, Przełącznik prądu ac.

Kod: P32010. **CONSULTAR DISPONIBILIDAD**

> Czas wyzwalania (nastawny): 0,5 ... 30 s

> Zakres nastaw: s / transf. ... / 5 A

Opis

The **WI** current detectors are electronic devices with an output relay that is connected or disconnected, in accordance with the level of current detected in the circuit.

- The trip level is adjusted with the potentiometer on the front of the unit.
- The reset process is automatic with currents under 10% of the trip level (Hysteresis).
- Delay: the connection and disconnection times of the output relay can be adjusted separately.
- Measurement of the current, depending on the type:
 - With built-in current transformer (net diameter Ø 25 mm)
 - Separate transformer, input.../5 A~

Aplikacja

WI's can be used in any application that needs to control the load:

- Power supply units for grinders or aggregate grinding units.
- Loads in extrusion machines
- Pump control
- Load on motors, etc.



WI/TS

Przełącznik prądu ac, montaż na szynie din

Kod: P32010.

Okular

Zasilanie prądem zmiennym

Częstotliwość	50 Hz
Napięcie znamionowe	220-240 V~ (-15%, +10%)

Właściwości mechaniczne

Wymiary (mm) szer. x wys. x głębok.	70 x 87 x 75 (mm)
Waga (kg)	0,17

Obwód pomiarowy napięcia

Napięcie izolacji	2,5 kV
-------------------	--------

Wyjścia cyfrowe przełączników

Łącznik do gniazd AC11 Ie / Ue	0,8 A / 240 V~
Łącznik do gniazd DC11 Ie / Ue	1,6 A / 30 Vdc
Prąd cieplny (Ith)	5 A
Napięcie izolacji	250 V ~
Żywotność elektryczna	1 x 10 ⁵
Żywotność mechaniczna	2 x 10 ⁶

Ochrona różnicowoprądowa

Czułość (IΔn), A	s / transformador ... / 5A
Czas opóźnienia (tΔ)	0,5 ... 30 s

WI
Przełącznik prądu ac.

KOD	TYP	Czas wyzwiania (nastawny)	Zakres nastaw
P32011.	WI/005-30	0,5 ... 30 s	0,5 ... 5 A
P32012.	WI/010-30	0,5 ... 30 s	1 ... 10 A
P32013.	WI/020-30	0,5 ... 30 s	2 ... 20 A
P32014.	WI/050-30	0,5 ... 30 s	5 ... 50 A
P32015.	WI/100-30	0,5 ... 30 s	10 ... 100 A
P32010.	WI/TS	0,5 ... 30 s	s / transf. .../ 5 A




WI/TS

Przełącznik prądu ac, montaż na szynie din

Kod: P32010.

Wymiary

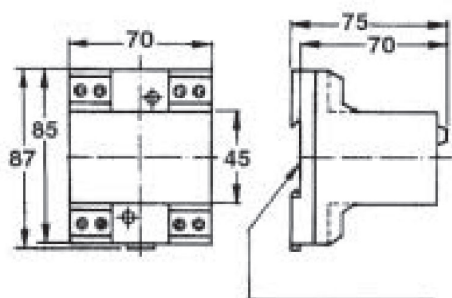

DIN 46277 (EN 50022)
FIJACIÓN / FIXING

Znajomości

